

M8x25 - 2ks
M10x35 - 12ks
M12x70 - 2ks (A)
M12x19 - 3ks (C)
M12x21 - 1ks (C)



M12 - 2ks (A)




PP8 - 2ks
PP10 - 12ks
PP12 - 2 ks (A)
PP12 - 4 ks (C)




P8 - 2ks
P10 - 12ks


C

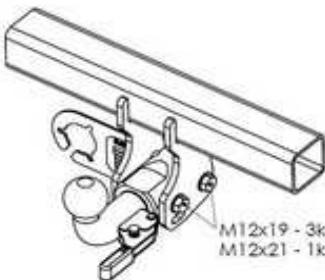

DETAIL

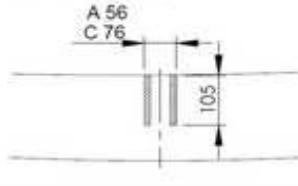

M12x19 - 3ks
M12x21 - 1ks

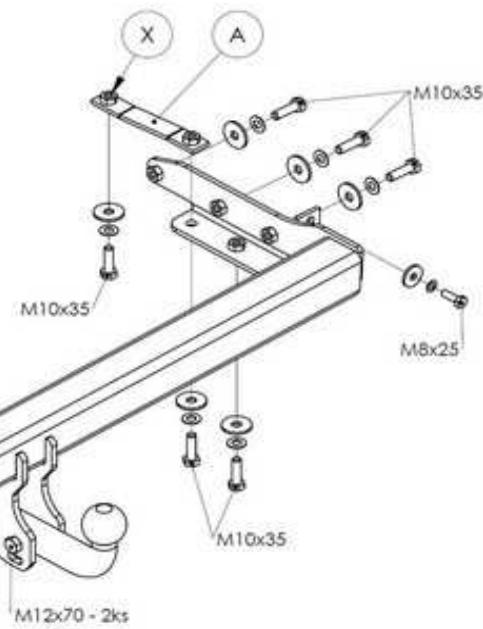

NISSAN X-TRAIL - N0401A/C - 5.3.2009

A

NÁVOD NA MONTÁŽ:

N0401

- 1. Demontujte zadný plastový nárazník s kovovými vložkami nosníkov. Kovové vložky sa už nepoužijú.
- 2. Demontujte umelohmotný spojler a vložku nárazníka.
- 3. Čažné zariadenie montujte po častiach podľa obrázka. Do nosníkov vložte držiaky A a zlahka ich uchýťte v otvoroch X skrutkami M10x35. Do nosníkov vložte rám B.
- 4. Následne všetky skrutkové spoje utiahnite momentom podľa tabuľky.
- 5. Demontujte spojovaciu guľu.
- 6. Elektroinstaláciu zapojte podľa návodu.
- 7. Skontrolujte správnosť pripojenia elektroinstalácie.
- 8. Vyrežte vybranie v podhláde nárazníka podľa obrázka – DETAIL.
- 9. Namontujte späť zadný plastový nárazník bez výstuhy, ktorú nahradza rám čažného zariadenia.
- 10. Prevedte spätnú montáž demontovaných častí.
- 11. Dotiahnite skrutky spojovacej gule (držiaka spojovacej gule) momentom podľa tabuľky.

FITTING INSTRUCTIONS:

- 1. Dismount bumper and metallic reinforcement beam of bumper. The beam will no longer be used.
- 2. Dismount the plastic spoiler and reinforcement beam of bumper.
- 3. Install the tow-bar in parts. Put holders A into beams and lightly grip it by screws M10x35 in holes X. Put frame B into beams.
- 4. Tighten the bolts using a torque-wrench to the specified torque.
- 5. Dismount the coupling ball.
- 6. Connect the electrical installation as described in the instructions for use.
- 7. Make sure the electrical installation is properly connected.
- 8. Cut a cavity in the bumper bottom as shown in the picture – DETAIL.
- 9. Re-mount the bumper without reinforcement beam. It is supplied now with the tow bar.
- 10. Reassemble any removed parts.
- 11. Tighten the screws of the linkage ball (holder of the linkage ball) to the torque shown in the table.

DÔLEŽITÉ UPOZORNENIA:

- V miestach stykových plôch sa musí odstrániť pružná ochrana karosérie vozidla.
- Vŕtané otvory treba ošetriť antikoróznom hmotou.
- Použite len dodaný spojovací materiál v predpisanej triede kvality.
- Elektrické zariadenie sa namontuje podľa podmienok prevádzky cestných vozidiel na pozemných komunikáciách.
- Údaj S o maximálnom zvislom zaťažení na gule je uvedený na výrobnom štítku čažného zariadenia.
- Na čažnom zariadení nie je možné nič upravovať ani meniť.
- Pred ukončením montáže je nutné prekontrolovať všetky spoje podľa tabuľky uťahovacích momentov!
- V prípade akýchkoľvek nejasností je nutné obrátiť sa na výrobcu čažného zariadenia.
- Výrobca nenesie zodpovednosť za škody spôsobené nesprávnym použitím výrobku.

IMPORTANT ATTENTIONS:

- Remove insulating material on a car body in grips and joints of a coupling device with a car body.
- Put the anticorrosive substance on the drilled holes.
- Use supplied mechanical strength jointing material.
- Wiring of a coupling device must be up to a standard and car maker requirements.
- Statement S about the maximum vertical ball downtime is printed on the tow bar label.
- On the tow bar is no modification possible
- Check all the joints, look in the table of the spinning moments, before finishing the montage!
- Contact the tow bar marker with any questions.
- The manufacturer is not responsible for the damages caused by wrong using on the product.

Tabuľka uťahovacích momentov skrutkových spojov pevnosti 8.8 / Table of specified torque and hardenss settings 8.8

M6 - 9,5Nm, **M8** - 23Nm, **M10** - 46Nm, **M10x1,25** - 49Nm, **M12** - 79Nm, **M12x1,25** - 87Nm, **M12x1,5** - 83Nm, **M14** - 125Nm, **M16** - 195Nm